

642-411 BL

Dart Aerospace Ltd.

Date: Thursday, 08/01/2009 1:40:25 PM
User: Julie Dawson

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	206 L HIGH GEAR SKIDTUBE
Job Number :	44503A		
Estimate Number :	10522		
P.O. Number :		Part Number :	D206642441
This Issue :	08/01/2009	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	D2650 REV E
First Issue :	/ /	Project Number :	
Previous Run :	41321A	Drawing Revision :	E
	Type :	Material :	
	SKIDTUBES	Due Date :	10/02/2009
Written By :		Qty:	1
Checked & Approved By :	JUD 09.01.08	Um:	Each
Comment :	Est Rev: H 05.10.11 Added D3429-1 per CHG002 KJ/CP/JLM Est Rev: I 08-05-01 add QC3 DD verified by: EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-441 CHG002

N/A HJ

2.0	D2620	Skidtube, 206 Skidtube
-----	-------	------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2620	Bent Tube 3" OD	44602

SL 9-1-9

3.0	D2647	Cap
-----	-------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2647	Fwd Cap	843846

BE 9-1-9

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

2-Remove ridge on inside of Fwd edge of tube as per Dwg D2650

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

A/R Aluminum Rod 843846 BE 9-1-9
m109560/m109213

4-Grind weld flush to cap on top surface only.

BE 9-1-9

SL 9-1-9

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 08/01/2009 1:40:25 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 44503A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

5-Cut aft end 138.60" from front of tube

6-Drill pilot holes using drill jig DT8025 & DT8169 (A,B,C,D). Open to Ø0.312".

7-Drill holes for wearplates using DT 8028-7. Open to Ø 0.297".

8-Open using #6 Drill Bit

9-Open holes for Tow Ring to Ø0.625" as per Dwg D2650, D2650-7 Drilling Detail

10-Remove inner indexing ridge on aft end of skidtubeas per Dwg D2650

11-Deburr and Blow out all chips form inside the tube

SL 92-9
9-1-10

5.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



AWM 9-1-12



①

Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

6.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BE 09/01/12

7.0

D26547

Web



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2654-7

Web

B 44549

Pm 09-01-12

8.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-7 Drilling Detail (without cutting fluid)

2-Countersink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr. Blow out chips. Grind alodine off around crossbolt spacer.

4-Bond D2654-7 web in place as per QSI 015Ensure holes line upAllow 12 Hrs. cure time before cutting

Start Date: 09-01-12 Time: 4:15

Finish Date: 9/1/12 Time: 7:45 AM

AWM
9-1-12

Pm 09-01-12

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 08/01/2009 1:40:25 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 44503A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

A/R Sikaflex-291

Sikaflex expiry date:

m109853
09-07-11

Pr 09-01-12

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

09/01/13 @

10.0

D2649

Cross Bolt Spacer



Comment: Qty.: 23.0000 Each(s)/Unit Total : 23.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

23 D2649

Crossbolt spacer

B44276

BE 09/01/13

11.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert cross bolt spacers D2649. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

A/R Aluminum Rod

m109213

BE 09/01/13

2-Grind welds flush as per Dwg D2650. Masking Tape access to inside of the Skidtube

3-Counterbore 5/16" x 0.750" deep as per Dwg D2650Deburr

DP 9-1-14

12.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2680-041

Nut Plate

B34599

DP 9-1-14

13.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 CCR264SS3-3

Rivets

M110122

DP 9-1-14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 08/01/2009 1:40:25 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 44503A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

14.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 M7885/3-4-3

Rivets 110139

DP 9-1-14

15.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

DP 9-1-14

16.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

S 02/01/14

17.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 02/01/14

18.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

Touch up Blodine a.m 09.01.150

19.0

SPRAY PAINTING

SPRAY PAINTING



Comment:

-PRIME GREY

B110199

-SPRAY PAINT DELFLEET BLUE

B110077

-CLEAR DELFLEET

B110161

ml 09 01 22 (1)

20.0

QC14

INSPECT SPRAY PAINT



Comment: INSPECT SPRAY PAINT

09-01-23 (1)

21.0

D26483

Wearpad



Comment: Qty.: 6.0000 Each(s)/Unit Total : 6.0000 Each(s)

Pick:

Qty Part Number

Description Batch

6 D2648-3

Wearpad 1344322

09-02-04 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 08/01/2009 1:40:25 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 44503A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

22.0

D265615

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-15

Wearshoe

B41125

HL

23.0

D265623

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-23

Wearshoe

B44281

HL

24.0

D265637

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-37

Wearshoe

B44154

HL

25.0

D34291

Wearpad



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D3429-1

Wearpad

B44164

HL

26.0

ALS41032130

Insert



Comment: Qty.: 60.0000 Each(s)/Unit Total : 60.0000 Each(s)

Pick:

Qty Part Number

Description Batch

60 ALS4-1032-130

Inserts

11105819

or (see QSI 017)

HL 09-02-04

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 08/01/2009 1:40:25 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 44503A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

27.0

AN960JD10L

Washer



Comment: Qty.: 62.0000 Each(s)/Unit Total : 62.0000 Each(s)

Pick:

Qty Part Number

Description Batch

60 AN960JD10L

Washer M109632

JH

28.0

MS27039108

Screw



Comment: Qty.: 62.0000 Each(s)/Unit Total : 62.0000 Each(s)

Pick:

Qty Part Number

Description Batch

62 MS27039-1-08

Screw M110467

JH

29.0

D26511

Plug



Comment: Qty.: 22.0000 Each(s)/Unit Total : 22.0000 Each(s)

Pick:

Qty Part Number

Description Batch

22 D2651-1 BLUE

Plugs B44191

JH

30.0

D26513

O-Ring



Comment: Qty.: 22.0000 Each(s)/Unit Total : 22.0000 Each(s)

Pick:

Qty Part Number

Description Batch

22 D2651-3

O-Rings B44277

JH

31.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 AN960JD416

Washer M108161

JH

09-02-04(X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 08/01/2009 1:40:25 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 44503A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

32.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 MS27039-4-06

Screw

M1109061

JP

33.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2646

BLUE

Aft Cap

B43801

JP

34.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

M110110

Sikaflex expiry date:

09107

2-Install O-Rings D2651-3 on plugs D2651-1 with Petroleum Jelly and install plugs as per Dwg D2650. Clean excess adhesive

3-Install MS27039-4-06 Screw as per DEO 9153

4-Inspect for foreign object per QSI 024

5-Install D2646 Aft Cap and seal with SikaflexClean excess adhesive

A/R Sikaflex-291

M110110

Sikaflex expiry date:

09107

6-Wing Walk as per Dwg D2650-7 and QSI 005 4.4

Batch: m110954

- *FL* 09/02/05

②

35.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

09/02/05 ②

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 08/01/2009 1:40:25 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 44503A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

36.0

PACKAGING 1

PACKAGING RESOURCE #1



12

Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: _____

PPP

44503

9/2/24

Sp

37.0

QC21

FINAL INSPECTION/W/O RELEASE



09/02/25

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF
09-02-24


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

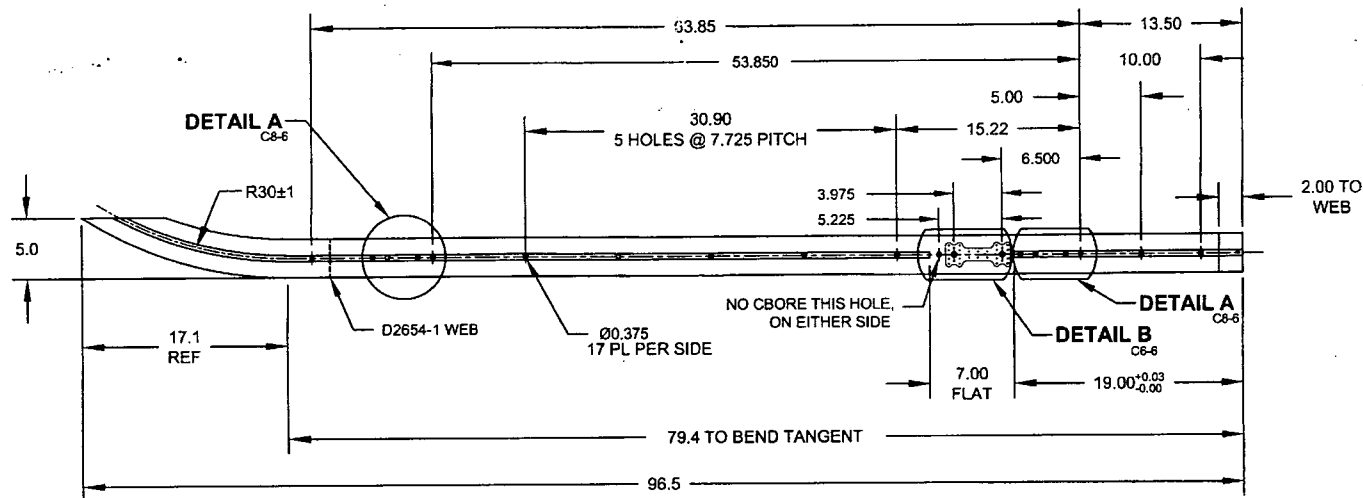

D2650-1 BENDING/DRILLING DETAIL


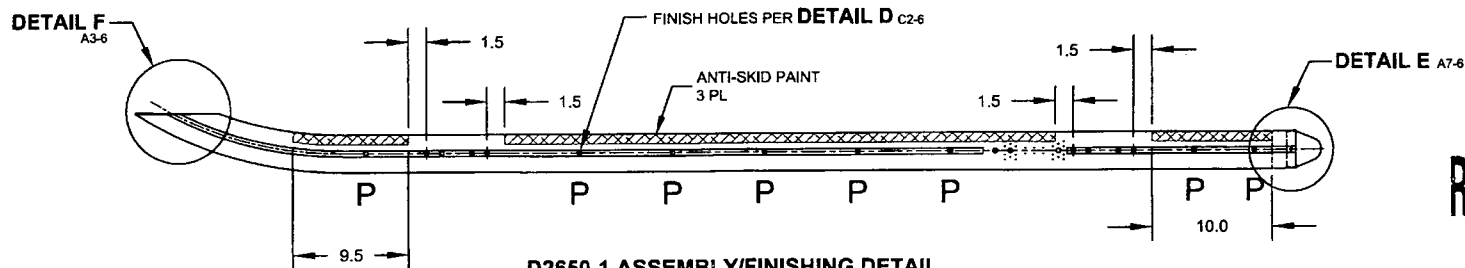


D2650-1 ASSEMBLY/FINISHING DETAIL

RELEASED
68 09 22 / 114

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 2 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
NO. 44503031

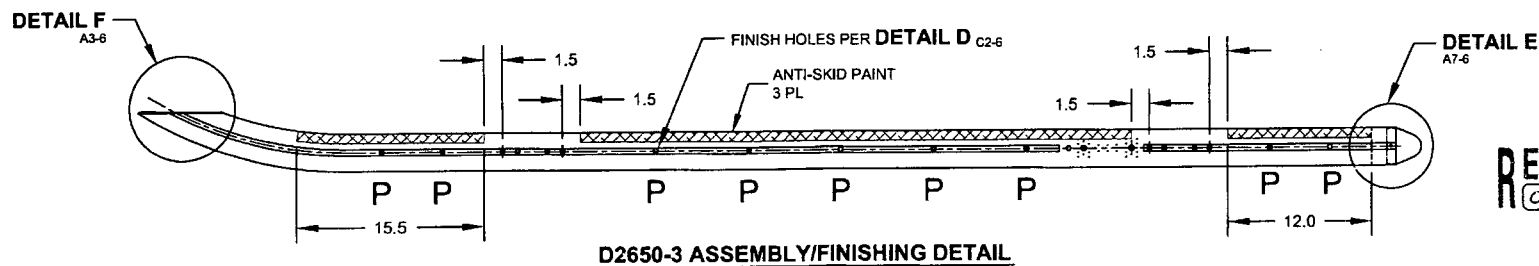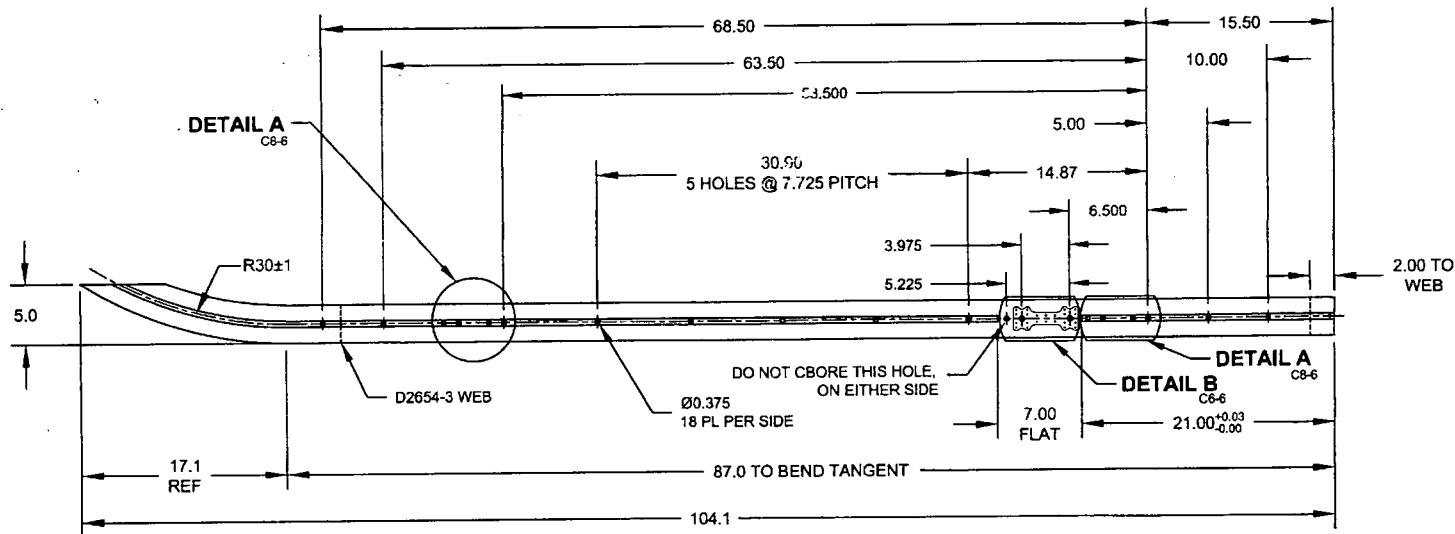


RELEASED
08-07-22/118

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 3 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	<small>COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AGREEMENT
WITHOUT NOTICE
WORK ORDER NO. 449034

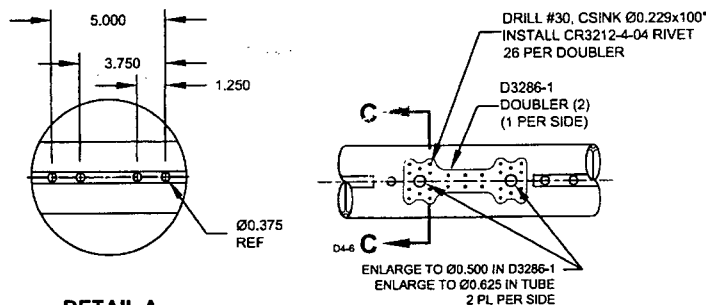


DETAIL A
SCALE 2X
C2-2
D7-2
C2-3
D7-3
C2-4
D7-4
C2-5
D6-5

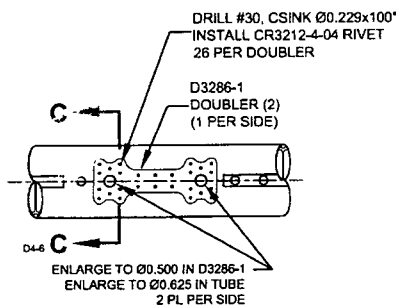


DETAIL B
SCALE 2X
C3-2
C3-3


SECTION C-C C7-6
SCALE NONE

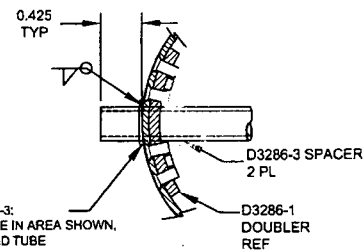

- TO INSTALL D3286-1/3:
1. GRIND OFF FLANGE IN AREA SHOWN,
FLUSH WITH ROUND TUBE
2. LOCATE & DRILL D3286-1 DOUBLER
USING DT3286-1T1
3. ENLARGE HOLES IN D3286-1 TO Ø0.500
4. ENLARGE HOLES IN TUBE TO Ø0.625
AND CHAMFER HOLE 0.030x45°
5. RIVET D3286-1 TO TUBE
6. INSERT D3286-3 SPACER
7. WELD IN PLACE.

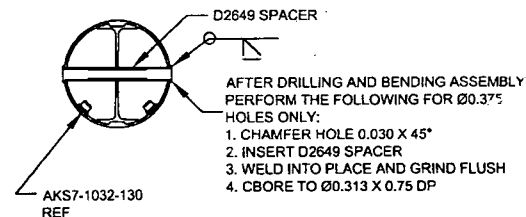


DETAIL D
FOR Ø0.375 HOLES ONLY
SCALE 3X
B4-2
B4-3
B4-4
B4-5

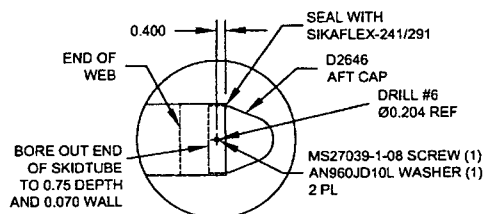

DETAIL E
SCALE 2X
B2-2
B2-3
B1-4
B1-5

ORIENTATION OF
D2680-041

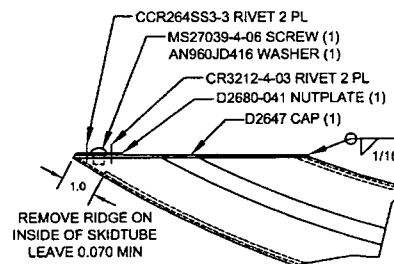

DETAIL F
SCALE NONE
B6-2
B6-3
B6-4
B6-5

- DETAIL F NOTES:**
1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE
NOTE: MASK THREADS IN D2680-041 PRIOR
TO FINISH

RELEASED
05-09-2013

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 6 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

NO. 245038
WORK ORDER
SUBJECT TO AMENDMENT
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY
245038

NO. 186

**AWS D17.1.2001
QUALIFICATION TEST RECORD**

Name: Barclay Elliot
Job number: B44225 A
Part number: 1206-642-241
Description: 206 Skid tube
Welding Process: Tig[☒] Mig[]
Base material: Alum
Current: AC[☒] DC[]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[]
Penetration: pass[☒] fail[]

UNACCEPTABLE

Cracks: pass[☒] fail[]
Undercut: pass[☒] fail[]
Pin holes: pass[☒] fail[]
Overlap (cold lap): pass[☒] fail[]
Porosity (surface): pass[☒] fail[]
Coloration: pass[☒] fail[]

Qualifier David Durl Date of Test Coupon 09/01/08
Welder Barclay Elliot Date of Test Coupon 09/01/08

The above named individual is qualified in accordance with AWS D17.1.2001 to weld